


Resolved Items:

Gen4 17-1 Software - Gen4 display was experiencing Coverage Map flips while on 17-1 software. That issue has been resolved with SF6000 3.80G software.

File Manager Defect – A new icon has been implemented to detect an internal hardware failure. After installing 18-1 software, there could be a red icon with the number 41 present, if an internal hardware failure is detected. The receiver will function as normal, but if the “Capture Data” button is pressed, the user will get the error of “Insufficient Storage” and not be able to collect data. The receiver will need to be replaced to have the ability to “Capture Data” and not receive the “Insufficient Storage” error.

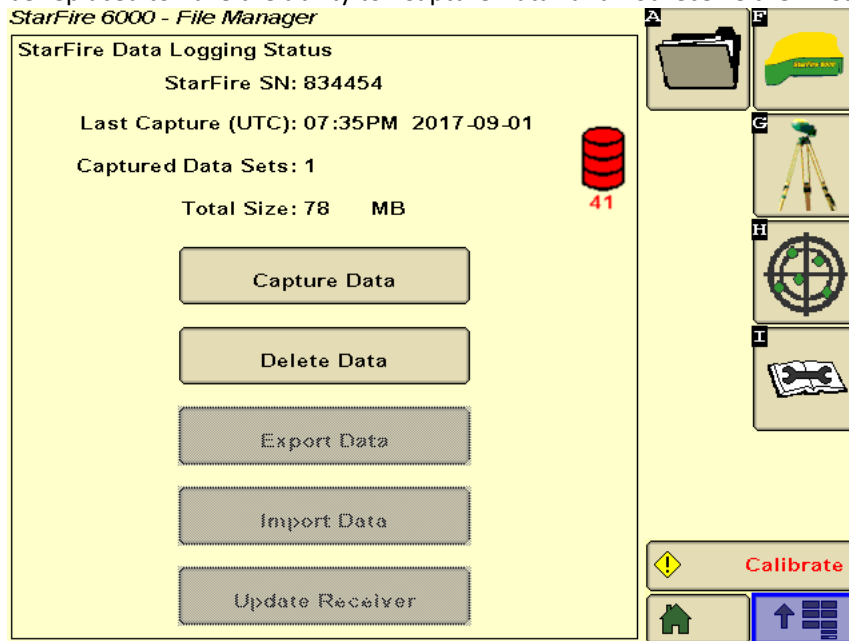

Machine Sync - While operating on 3.70M software, the SF6000 follower may experience surging while connected to an SF6000 leader also running on 3.70M. This issue has been resolved with 3.80G software. Both leader and follower will need to be updated.

Release Notice

These are software release notes for GreenStar™ 3 2630 and related products. Release Notes can be found on www.stellarsupport.com. Note: Your use of the software is governed by the End User License Agreement included with the software.

Copyright © 1996-2018 Deere & Company